	GeneMarker Manual	
Status:Published	Gonorvanici ivianuai	Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	1 OF 30

GeneMarker Manual


I. General Overview

Main Analysis Window

There are four major displays in the main analysis window.

- 1. Navigator; Sample File Tree
- 2. Electropherograms
- 3. Report; Report Table
- 4. Project Summary

See **Helpful Icons Index** for further details.

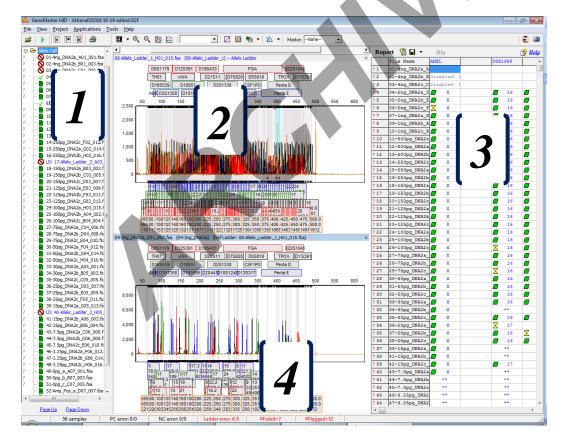

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	2 OF 30

Navigator; Sample File Tree

This view lists all the samples that are included in the project. Prefixes LD, PC and NC are labeling the allelic ladder, positive control and negative control

The sheet icon to the left of the sample name indicated the quality of the internal lane standard (ILS) with the following color/code:

- i. Green = High Lane Quality; Passing Size Standard
- ii. Yellow = Requires Verification
- iii. Red strike through = No Sizing Occurrence; failed to call size
- iv. Red Question Mark = one or more quality criteria are not met based on the analysis parameters; See **Quality Reasons Index** for more details.

Project Summary

This bar located at the bottom of the main analysis screen summarizes the project as well as alerts the analyst to samples that did not pass analysis parameters.

New	22 samples	PC error: 1/1	NC erron 3/3	Ladder error: 0/1	#Failed=1	#Flagged=19


- 1. **New** reflects the data set is not a project that has been previously analyzed.
 - a. If the first column reads **Modified**, the project was previously analyzed in the software.
- 2. The second column denotes the number of samples (including controls) contained in the data set.
- Columns 3-5 indicate the number of controls in the data set that do not meet the quality criteria set in the software.
- 4. Column 6 denotes the number of samples that were disabled.
- 5. Column 7 denotes the overall number of samples, except the allelic ladder, that do not meet the quality criteria set in the software.

NOTE: Flagging features are an indication of potential failures. The ultimate decision of passing/failure is made by the analyst after further evaluation.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	3 OF 30

Calibration Chart Window

There are three major displays in the calibration chart window.

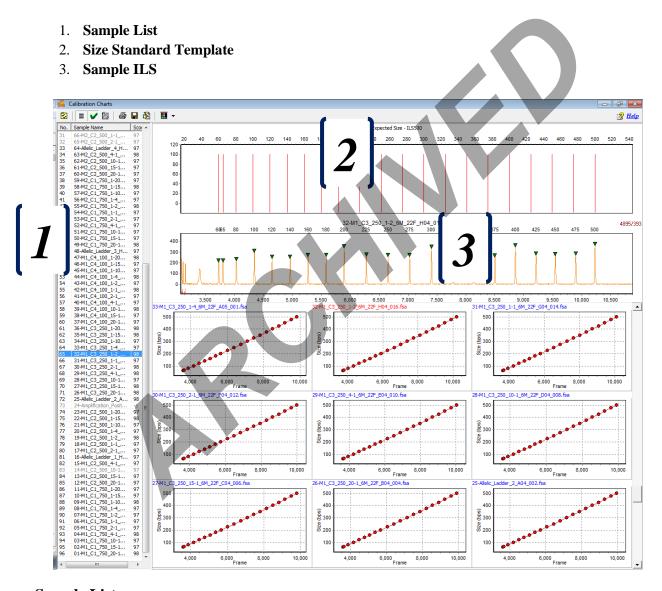

Sample List

This view lists all the samples that were processed in the project. The **Score** column represents how well the size standard template and the sample ILS match. The closer the score is to 100, the better the match.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	4 OF 30

The sample may fail automatically if the size standard is bad enough, or may have to be failed manually by the analyst.

Size Standard Template


The template highlights all the peaks that should be labeled in the corresponding sample ILS for easier comparison.

Samples ILS

The sample ILS displays the peaks that were detected. As well as the approximate start of the data analysis view, indicated by the dash line.

All Color Browser Window

There are four features in the All Color Browser that allow for straightforward review of the sample.

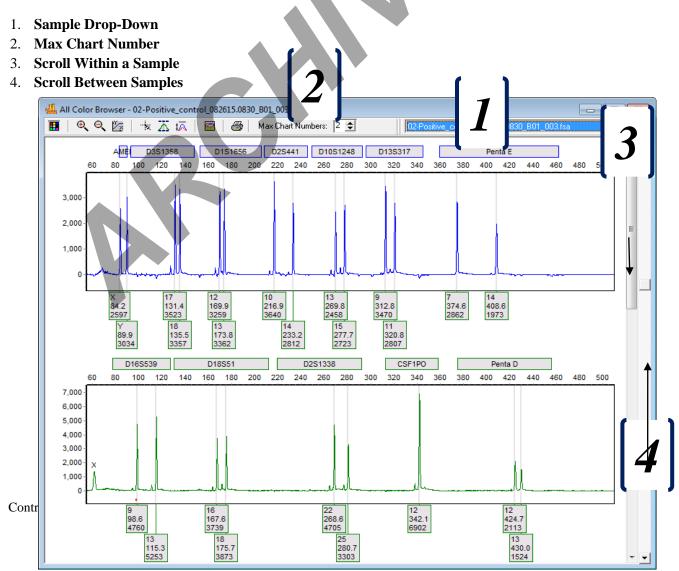

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	5 OF 30

Sample Drop-Down


The sample drop-down lists all the samples within a project. A user can move between samples by clicking on the sample name instead of scrolling through all electropherograms.

Max Chart Number

Max chart number views each sample by the number of dye lanes as per the user's needs during sample analysis.

Allele Labels

When analyzing samples in the **Main Analysis** window or the **All Color Browser** window, alleles may be colored yellow or red.

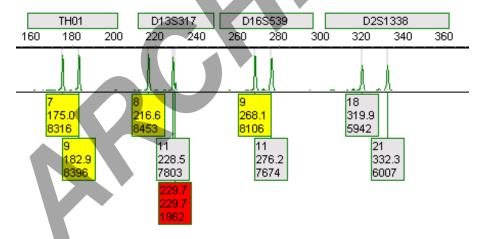


This indicates that one or more quality criteria have not been met in the software. See **Quality Reasons Index** for more details.

NOTE: Flagging features are an indication of potential artifacts and/or allelic imbalance, or peak saturation. The ultimate decision of passing/failure is made by the analyst after further evaluation.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	6 OF 30

Peak Table

When analyzing samples in the **Main Analysis** window or the **All Color Browser** window, a peak table maybe added to supplement analysis by clicking Show Chart/Table icon

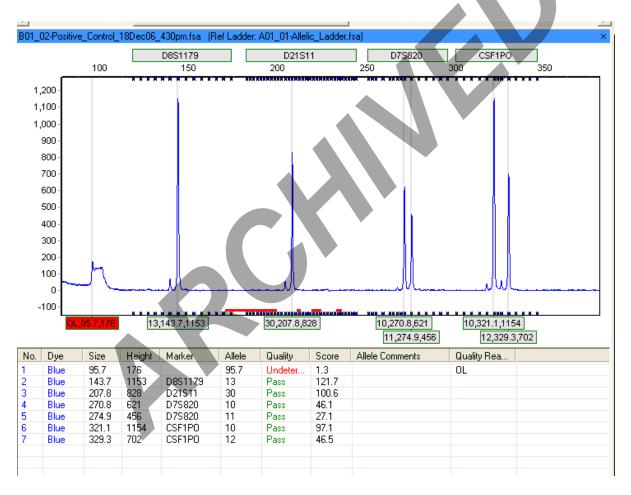


This table will indicate to an analyst which alleles were flagged and which quality reason was triggered. See **Peak Table Options Index** for further details.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	7 OF 30

II. Load Data

- 1. To start your project, go to File \rightarrow Open Data \rightarrow Add
 - i. Navigate to the network folder containing the data files (i.e. the .fsa files) to be analyzed.
 - ii. Select files to add (include only one ladder per project)
 - i. Hold Ctrl key to select multiple files
 - ii. If analyzing all files hold Ctrl and A keys
 - iii. Select Open
 - i. Ensure correct files are added to list
 - iv. **Deselect** Auto-Elevate

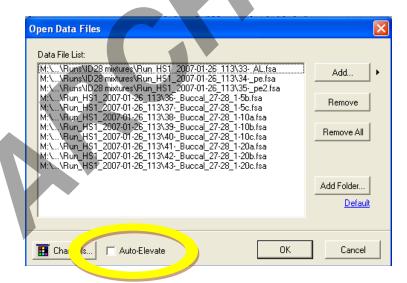

- v. Select **OK**
- 2. Ensure that prefixes LD, PC and NC are labeling the allelic ladder, positive control and negative control, respectively, in the Sample File Tree.
 - i. If they are not, **right click** on the sample name in the **Sample File Tree** \rightarrow **Set Sample Type** \rightarrow **Select appropriate sample type**

Controlled versions of Department of Forensic Biology Manuals only exist in the Forensic Biology Qualtrax software. All printed versions are non-controlled copies.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	8 OF 30


3. Click Run Project located in the top toolbar.




III. Run Wizard

1. In Template Selection window, select the appropriate existing template.

a. PowerPlex Fusion® LIZ

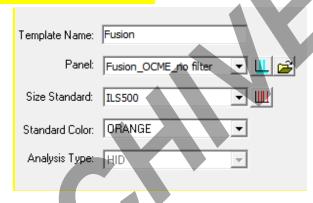


b. Yfiler® LIZ

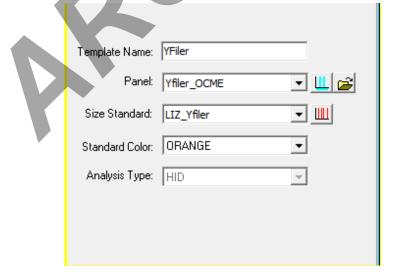


	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	9 OF 30

- 2. Click Next
- 3. In the **Data Process** window, ensure the following settings are used based on amplification kit.
 - a. PowerPlex Fusion® / PowerPlex Fusion® STRmixTM

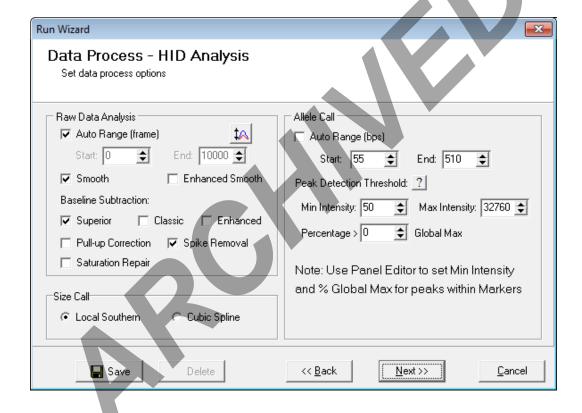

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	10 OF 30

b. Yfiler®

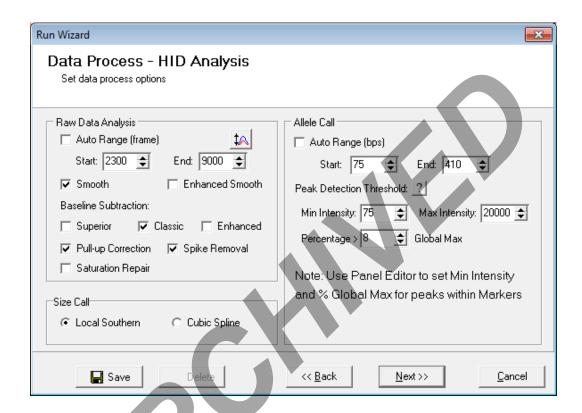

- 4. Click Next
- 5. In the **Additional Settings** window, ensure the following settings are used.
 - i. Allelic Ladder:
 - i. Fusion Auto Select Best Ladder is Checked
 - **ii. YFiler** Auto Select Best Ladder is **Unchecked**. Select Ladder for analysis from drop down box.
 - ii. Auto Panel Adjustment: Box is checked
 - **Select the Positive Control Template** using the Positive Control dropdown.
 - i. For Yfiler® Yfiler MPC
 - ii. For PowerPlex Fusion® PP_Fusion
 - iv. Under Allele Evalution Peak Score, Reject 0.00 and Pass 1.00
 - v. Deselect Mixture Evaluation

Note: Do NOT click Save within the Data Process Window. This will overwrite the template for all analysts.


	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	11 OF 30

- 6. Click $OK \rightarrow Once$ data has finished processing Click OK
- 7. On the top left corner of the screen, Click File \rightarrow Click Save Project \rightarrow Navigate to desired folder and save project using the naming system based on the instrument, date, injection number(s), kit and analysis set (i.e. Newton090615 8-11U A)

Checking the Allelic Ladder IV.

- 1. There are two areas in the Main Analysis window that indicate if the allelic ladder used for analysis has passed.
 - a. In the Sample File Tree, a red question mark next to the allelic ladder would indicate a potentially failed ladder.
 - b. In the **Project Summary**, a ladder error would indicate a potential failed ladder.
- 2. Visually confirm all expected alleles in the allelic ladder are present. This may be done in the Main Analysis Window or the All Color Browser.
- 3. If the ladder used for analysis failed, click **File** from the menu bar \rightarrow Click **Open Data** \rightarrow Highlight the failed ladder from the Data File List \rightarrow Click **Remove** \rightarrow Click **Add...** \rightarrow Navigate to the .fsa files \rightarrow Select a different ladder for analysis \rightarrow Click **Open** \rightarrow Click **OK**. Return to Section II. Load Data, step 2 and proceed.

Checking the Size Standard V.

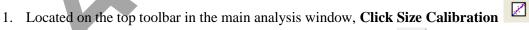



- 2. In the Calibration Charts window, Click Chart Synchronize
- 3. Click Sample Name header to sort samples in order. In the Sample List, either Click on a Sample or Navigate using the Up/Down Arrows, check the size standard for each sample as per the amplification kit.
 - a. If the peak is recognized by the software, a green inverted triangle appears at the top of the peak.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	12 OF 30

- b. If the size standard needs manual editing by adding or deleting a peak; **Right Click on**the desired peak → Select Delete/Add Peak → Right Click Again → Select Update
 Calibration
- c. Close Calibration Charts window.
 - i. If any sample is automatically marked as disabled by the software, review the size standard in the Calibration Charts window to ensure this was due to failing or poor size standard. If it is confirmed that the sample has a failing or poor size standard, a rerun code must be applied to that sample. **Right click** on the sample in Sample File Tree within Main Analysis Window → Click Edit Comments → Enter rerun code in Comments field → Click OK
 - ii. If any sample has failing or poor size standard, and was not automatically marked as disabled by the software, any peak labels present must be deleted. Open the All Color Browser analysis window → navigate to the relevant sample(s) → highlight all peaks in one dye by holding down Ctrl, left click and dragging around any peaks present in that dye → click **Delete** to remove the peak labels → repeat for each dye
- 4. In the **Main Analysis** window, **Click on the Down Arrow** next to the Show Color located in the top toolbar. → **Click Hide All**
- 5. In the Sample File Tree, Right Click on Allele Call →Click Select Max
- 6. In the **Main Analysis** window, **Click on the Down Arrow** next to the Show Color located in the top toolbar. → **Click ORANGE**
- 7. Adjust axis to view size standard depending on amplification kit



- a. On the top toolbar, Click Set Axis icon
- b. Click Fixed 'X' → enter X axis range
 i. PowerPlex Fusion® = 55-510
 - ii. Yfiler® = 75-410
- c. Click Set Axis again \rightarrow Select Auto Fit Y

Note: Analysts can zoom in/out by using the zoom icons additional option, hold down the left button on the mouse and drag the dotted box that appears from the upper left to the lower right (around the desired "zoom in" area). To zoom out, hold down the left button on the mouse again dragging the box from lower right to upper left. To scroll while zoomed in, right click and hold while dragging the mouse in the direction you want to scroll.


	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	13 OF 30

- 8. Review size fragments by ensuring that all required peaks are labeled within +/- 0.5bp of the fragment size.
 - a. If a peak is not labeled, then the size standard fails.
 - i. Right click on sample in Sample File Tree within Main Analysis Window → Click Edit Comments → Enter rerun code in Comments field → Click OK
 - ii. If any sample with failing or poor size standard has peaks called, the peak labels of those peaks will need to be deleted. Open the Browse by All Color analysis window → navigate to the relevant sample(s) → highlight all peaks in one dye by holding down Ctrl, left click and dragging around any peaks present in that dye → click **Delete** to remove the peak labels → repeat for each dye

Size Standard


PowerPlex Fusion®

i. PowerPlex Fusion® samples are run with the WEN ILS500. ILS500 has a range of 60-500bp (Fragments: 60, 65,80, 100, 120, 140, 160, 180, 200, 225, 250, 275, 300, 325, 350, 375, 400, 425, 450, 475, 500). All size fragments must be labeled in the calibration chart and the orange dye lane.

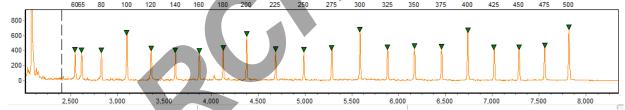

Yfiler ®

- i. Yfiler® samples are run with LIZ 500. The LIZ_Yfiler size template for LIZ 500 does not have the 250 bp sizing peak labeled as it is not utilized for data sizing. This peak should not be labeled within the Calibration Chart window. All other size calls in the range of 75-400 bp peaks must be properly match scored/sized
- ii. When viewing the size standard in the orange dye lane in the All Color Browser, the 250bp will be labeled. This peak is not being used for sizing.

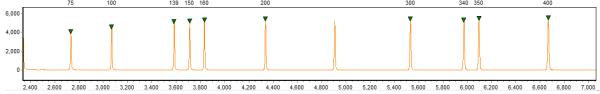

VI. Analyzing Samples

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	14 OF 30

Analysis of the data can be performed in the **Main Analysis** window and/or the **All Color Browser** window.

- 1. Adjust axis to view samples depending on amplification kit
 - a. On the top toolbar, Click Set Axis icon
 - b. Click Fixed 'X' \rightarrow enter X axis range
 - i. PowerPlex Fusion® = 55-510
 - ii. Yfiler= 90-340
 - c. Click Set Axis again → Select Auto Fit Y

Note: Analysts can zoom in/out by using the zoom icons additional option, hold down the left button on the mouse and drag the dotted box that appears from the upper left to the lower right (around the desired "zoom in" area). To zoom out, hold down the left button on the mouse again dragging box from lower right to upper left. To scroll while zoomed in, right click and hold while dragging the mouse in the direction you want to scroll.

- 2. If using the All Color Browser window, adjust Max Chart Number to 2
- 3. Analyst may choose to use the Peak Table during analysis. Click the icon to turn the chart/table on and off.
- 4. Editing a peak
 - a. Click on Peak to Highlight \rightarrow Right Click \rightarrow Click Edit Comments \rightarrow Select Edit From List or Type New Edit (refer to edit code list) \rightarrow Click OK.
 - To select multiple peaks for editing, Hold the Ctrl key + left mouse click → Drag the mouse to highlight intermittent peaks
 - c. Once the correct Edit is selected, **highlight the peak and press Delete key** to remove the label from the peak.
 - d. To check peak history \rightarrow Right click on peak \rightarrow Click view history
 - i. Any changes made to the peak will be listed in order from most recent down. Click on any line to view specific change details in the Current/Old Values: window. Scroll all the way to the right to view edit code applied to peak in Allele Comments column.

Note: If a label has been removed from a peak and needs to be restored, **Click on Peak** to Highlight \rightarrow **Right Click** \rightarrow **Undelete.** If an edit needs to be removed from a peak \rightarrow right click on peak \rightarrow click edit comments \rightarrow remove text from Comments: box so the text field is blank \rightarrow Click OK (the E will still be visible but the edit comment will be removed)

Controlled versions of Department of Forensic Biology Manuals only exist in the Forensic Biology Qualtrax software. All printed versions are non-controlled copies.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	15 OF 30

Note: +/- 4 stutter should not be manually edited from **evidence** samples in Fusion. This edit is only to be used in positive control samples, exemplar samples, and Yfiler.

5. Scheduling Re-Runs

- a. If a sample **Failed** (over saturation, bad size standard, no data, etc..) → Right click on sample in Sample Tree within Main Analysis Window → Click Edit Comments → Type Re-Run Code in the comment box → Click OK
 - i. All peak labels must be removed from **failed samples**. Open the Browse by All Color analysis window → navigate to the relevant sample(s) → highlight all peaks in one dye by holding down Ctrl, left click and dragging around any peaks present in that dye → click **Delete** to remove the peak labels → repeat for each dye
- b. If sample did not fail but re-run is desired → Right click on <u>sample</u> in <u>Sample Tree</u> within Main Analysis Window → Click Edit Comments → Type Re-Run Code in the comment box → Click OK

6. Over-Saturation

a. Check for saturated samples → In the Main Analysis Window electropherogram a pink line will indicate the possible saturation of peak. This indication will also be noted in the Peak Table as <SAT> for that allele in the Allele Comment field. If the sample has excessively saturated peaks (>10,000 RFU or split peaks) this sample must be rerun at a dilution.

	GeneMarker Manual	
	Genemarket Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	16 OF 30



- 7. Once the entire run has been reviewed, all edits have been made and labels have been removed from all edited peaks, on the top left corner of the screen, Click File → Click Save Project
 - a. You must save over the existing project every time you save


VII. Exporting for LIMS (all systems and sample types)

- 1. In the report display section of the main analysis screen, click on the arrow next to the Save Report icon _____. Ensure the "Save LIMS report" is selected.
 - a. In the LIMS report settings window that pops up, ensure the settings are as follows:


The Size Range will be the same as the X- axis range for analysis:

90-340 for Yfiler and 55-510 for Fusion.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	17 OF 30

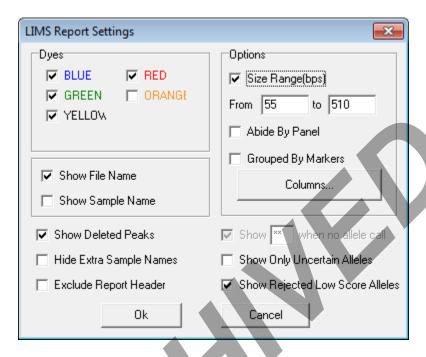

b. In **Options**, click on "Columns..."; use the Add/Remove buttons to ensure the Selected Columns are present and listed in the order that follows:

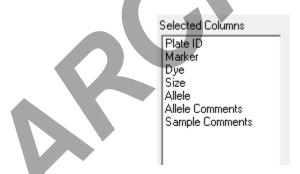

This is crucial to proper LIMS importation.


2. Click **OK**; Click OK again in the Allele Report Settings window. Save the file as type "Excel File (*.xlsx;*.xls)" under the appropriate run name (make sure to delete suffix "_AlleleReport").

	GeneMarker Manual	
	Ochewarker Manuar	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	18 OF 30


VIII. Exporting Electropherograms (all system and sample types)

In the main analysis window,

- Click Set Axis → Click Fixed X axis The Size Range will be the same as the X- axis range for analysis:
 - a. 55-510 for Fusion
 - b. 90-340 for Yfiler
- Select Auto Fit Y
- 1. Click Tools → Export Electropherogram
- 2. Set Output Folder to desired location for project PDFs by clicking icon

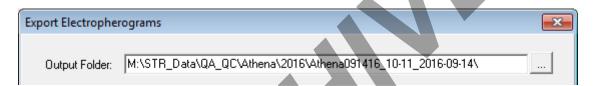

3. Ensure settings match below: Make sure to select PDF as export format

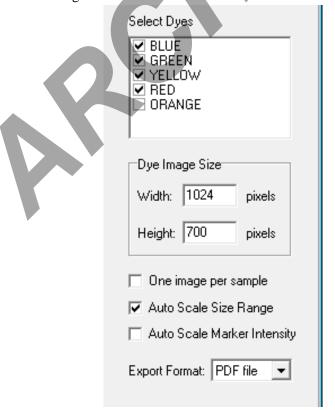

Controlled versions of Department of Forensic Biology Manuals only exist in the Forensic Biology Qualtrax software. All printed versions are non-controlled copies.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	19 OF 30


- 4. In the suffix field enter the run name with a "_" before it. (Ex: _Newton061316 88-89U A)
- 5. Printing the **ladder**: Right click in the sample list → click Deselect All → Check the box for the ladder → In prefix field enter **ladders** → click **Export**
- 6. Printing the **controls**: Uncheck the box for the ladder and check the box for all controls in the run → In the prefix field enter **controls**_→ click **Export**
- 7. Printing the **samples**: Right click in the sample list → click Select All → Uncheck the box for all ladders and controls in the run, leaving all samples selected → clear the prefix field → click **Export**. This will create 4 PDFs for every sample, one for each dye.
- 8. Import all PDFs into LIMS.



	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	20 OF 30

IX. Fusion Exemplars Only - Exporting EXEMPLAR table for $STRmix^{TM}$ input (for evidence table instructions see section XII)

1. In Main Analysis Window Click icon → Select Show All. In the report display section of the main analysis screen, click on the report settings icon Make sure settings match below:

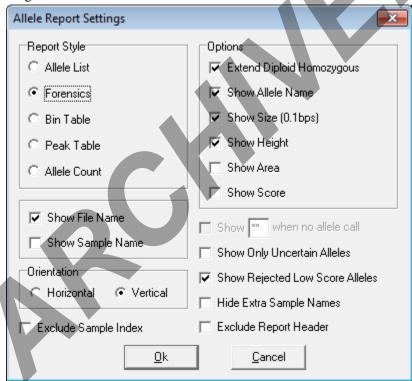


- 2. In the report display section of the main analysis screen, click on the down arrow next to the Save Report icon _____. Ensure the "Save Report" is selected.
- 3. Navigate to appropriate folder and save file as "Run name_SM"

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	21 OF 30

- 4. For proper STRmixTM import the GeneMarker[®] to STRmixTM macro needs to be run.
 - a. Open the exported project excel file from Step 1 above.
 - b. Open GeneMarker® to STRmixTM macro.
 - c. Follow the instructions on the "instructions" tab.
 - d. After macro has run click "save as" within the GeneMarker® to STRmixTM macro file.
 - h. Change the file type to ".txt" (text, tab delimited)
 - i. Navigate to folder containing your project data and save file there.

X. Fusion Evidence Only - STRmixTM Analysis (stutter filters off)

- 1. Begin by importing the data from the initial analysis into LIMS to generate the edit sheet. Have the edit sheet open in LIMS as you perform the second analysis with stutter filters off for STRmixTM to refer to and ensure the same edits are being made the second time.
- 2. If Project is still open \rightarrow Click Run Project | located in the top toolbar.
 - a. If project is not open → Click File → Open Project → Navigate to run → select project → click open → Click Run Project located in the top toolbar.
- 3. In Template Selection window, select the appropriate existing template.

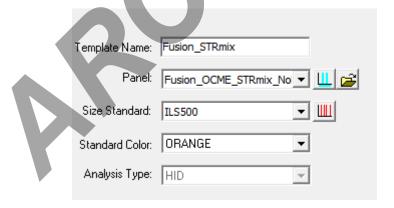


4. Click Next

a. In the **Data Process** window, ensure the following settings are used based on amplification kit.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	22 OF 30

i. PowerPlex Fusion®_STRmixTM

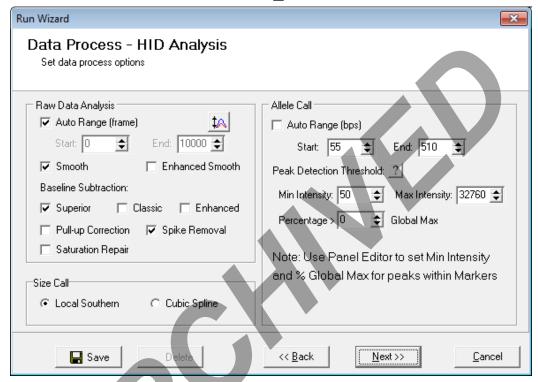


- 5. Click Next
- 6. In the Additional Settings window, ensure the following settings are used.
 - a. Make sure Auto Select Best Ladder is selected
 - b. Auto Panel Adjustment: Box is checked
 - **c. Select the Positive Control Template** using the Positive Control drop-down.
 - i. For PowerPlex Fusion® PP Fusion
 - d. Under Allele Evalution Peak Score, Reject 0.00 and Pass 1.00
 - e. Deselect Mixture Evaluation

Note: Do NOT click Save within the Data Process Window. This will overwrite the template for all analysts.

7. Click OK \rightarrow A window will pop up:

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	23 OF 30

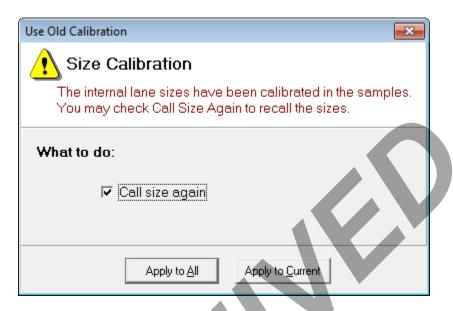


Check "Call size again" and Click Apply to All → Allow data to process → Click OK

- 8. On the top left corner of the screen, Click File → Click Save Project → Save Project with suffix _SM
- 9. Perform a second analysis of this run
 - a. Do not recheck or edit Ladder, Size Standard or Controls. Passing controls and size standard are determined by the initial analysis.
 - b. In Sample Tree → Right click and disable every control in the project except the Ladder. Enter Comment "Not Used"
 - c. Ensure any samples that failed initial analysis are disabled.
 - d. Remove the labels from the same peaks that were edited in the initial analysis. It is not necessary to enter edit codes again.
 - e. If a sample had a rerun code during the initial analysis it is NOT necessary to enter the rerun code again.
- 10. Once the entire run has been reviewed, and labels have been removed from all artifact peaks, Click File → Click Save Project


	GeneMarker Manual	
Status:Published	Generalkei wandai	Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	24 OF 30

XI. Fusion Evidence Only - Exporting Electropherograms after STRmixTM Analysis (samples only)

- 1. In the main analysis window, set the fixed X axis to 55-510 and set the Y axis to Auto Fit Y.
- 2. Click Tools → Export Electropherogram

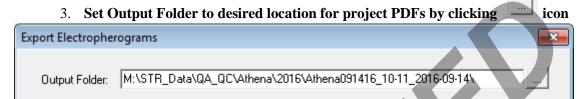

4. Ensure settings match below:

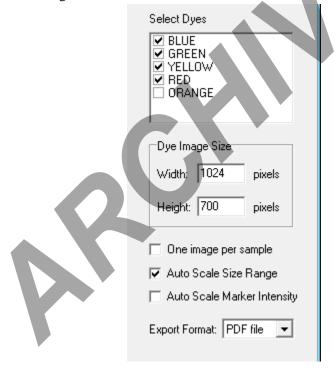



- 5. In the suffix field enter the run name with a "_" before it followed by _**SM** (Ex: _Newton061316 88-89U A_SM) to indicate STRmixTM analysis.
- 6. Printing the samples only: Right click in the sample list → click Select All → Uncheck the box for all ladders and controls in the run and any samples that were disabled or failed, leaving only the passing samples → clear the prefix field → click Export. This will create 4 PDFs for every sample, one for each dye.
- 7. Import PDFs into LIMS.

	GeneMarker Manual	
	Generalkei Manuai	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	25 OF 30

XII. Fusion Evidence Only - Exporting EVIDENCE table for $STRmix^{TM}$ input

1. In the report display section of the main analysis screen, click on the report settings icon

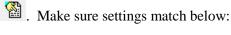

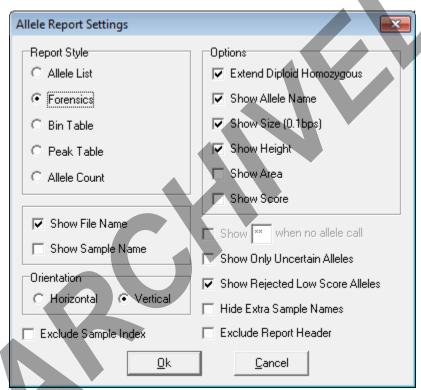

- 5. Click OK
- 6. In the report display section of the main analysis screen, click on the **arrow** of the Save Report icon ...
- 7. Click Save Report.
- 8. Navigate to appropriate folder and save file as type "Excel File (*.xlsx;*.xls)" under the appropriate run name (make sure to delete suffix "_AlleleReport"). Click Save.
- 9. For proper $STRmix^{TM}$ import the $GeneMarker^{@}$ to $STRmix^{TM}$ macro needs to be run.
 - a. Open the exported project excel file from Step 1 above.
 - b. Open GeneMarker® to STRmixTM macro.
 - c. Follow the instructions on the "instructions" tab.
 - d. After macro has run click "save as" within the GeneMarker® to STRmixTM macro file.

Controlled versions of Department of Forensic Biology Manuals only exist in the Forensic Biology Qualtrax software. All printed versions are non-controlled copies.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	26 OF 30

- h. Change the file type to ".txt" (Text, tab delimited)
- i. Navigate to folder containing your project data and save file there.

XIII. Reporting Analyst/Case Tech Reviewer Sample Review

- 1. Verify all STR runs associated with case file samples checking for:
 - i. Passing Allelic Ladder was used to analyze run
 - ii. Passing controls were present
 - iii. Passing Size Standard for relevant case file samples
 - iv. Appropriate edits were made for relevant case file samples and labels were removed from edited peaks
 - v. Any relevant samples needing re-run were scheduled and/or disabled
- 2. Determine if sample is suitable for comparison/STRmixTM analysis
- 3. If a true OL/OB was detected in a sample the allele must be assigned a call for STRmixTM
 - i. Open STRmixTM .txt input file and replace OL/OB call with true call



	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	27 OF 30

HELPFUL ICONS INDEX

Main Toolbar Icons

Icon Name		Function
>	Run Project	Opens Run Wizard for processing the data.
	Show/Hide Toggles	Allows user to show/hide the frames for the Sample File Tree, Synthetic Gel Image and Report Table, respectively.
II •	Show Color	Allows user the choice of viewing/hiding all color lanes or single dye lane layer (with single left mouse click on the icon, obtain single dye view)
hold down left mouse button and draw a box; dragging from top left		Allows for more discriminate view of electropherogram. Alternately, hold down left mouse button and draw a box; dragging from top left corner to bottom right zooms in on image while dragging from bottom right corner to top left zooms out.
₩ _×	Set Axis	Default sets Y-axis by maximum peak intensity for the sample displayed. The other 2 options either auto-fit the Y-axis by the peak intensity of the alleles displayed, or allow for setting the X- and Y- axes ranges manually.
	Browse by All Colors	Allows for comparative view display of sample electropherograms by dye color. Individual samples can be selected from the drop down menu in the upper right corner of the All Color Browser display window.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	28 OF 30

Allele Call Icons available after raw data processing only; Sample File Tree Allele Call folder must be selected

Icon	Name	Function
	Size Calibration	Displays calibration charts for linearity of lane analysis.
	Show Chart/Table	Allows user to toggle the display to show only the <i>Peak Table</i> , the <i>Peak Table</i> and the <i>Electropherogram</i> , or just the <i>Electropherogram</i> .
₩ •	Save Peak Table	Allows user to export the <i>Peak Table</i> as an Excel(.xls) file or a tab- delimited Text (.txt) file.
<u> </u>	Call Allele	Allows user to call alleles by sample(s), by marker or by dyes. Allows user to make some modifications to the threshold/filter settings without having to activate Run Wizard again (i.e. Peak Detection Threshold, Stutter Peak Filter and Peak Score Threshold).
Marker: -None	Marker Drop-down Menu	Allows user to select a marker to view. Available after the samples have been compared to a Panel.
***	Event Log	Displays the processing success/failure of each dye lane.
	Magic Wizard	Activates the Start Your Project, Run and/or Report dialog boxes.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	29 OF 30

Browse By All Colors Icons

Icon	Name	Function
⊕ ⊖	Zoom In/Zoom Out	Same use as in the Main Analysis Screen.
 	Show/Hide Mouse Cross Lines	Allows user the option to show/hide X- and Y- axis grid lines that appear at the tip of the mouse cursor along with the basepair size and RFU value of the mouse cursor position.
本	Show/Hide Bin Ranges	Allows user the option to show/hide the Bin brackets at the top and bottom of the electropherogram.
t⊼	Auto Scale Markers	Allows user the option to adjust the RFU intensities of low peaks to match the intensity of the highest peak in the dye color. When low peaks are increased, the intensity magnification factor is noted in the marker (can adjust from 2X to 8X).
	Print	Opens the <i>Print Report</i> settings box. Also accessible in the Main Analysis screen.

Report Table Icons located directly above the Report Table.

Icon	Name	Description
	Report Settings	Allows user to customize Report Table display settings.
	Save Report	Allows user to export the <i>Report Table</i> as an Excel (.xls) file or tab- delimited Text (.txt) file.

	GeneMarker Manual	
Status:Published		Document ID: 6311
DATE EFFECTIVE	APPROVED BY	PAGE
01/03/2017	Nuclear DNA Technical Leader	30 OF 30

Bin Column	Allows user to select which bins to include/exclude in the Report Table (check with TSL as this is not accessible at this time)
------------	---

PEAK TABLE OPTIONS INDEX

Dye	dye lane location of peak
Size	peak basepair size (x-axis)
Height	value given as relative frequency units (RFU) of the peak (y-axis)
Height Ratio	peak height divided by height of highest peak in the dye lane or Marker
Area	indicates the area under the curve of the peak; calculated based on x-axis Start/End column settings
Area Ratio	peak area divided by area of highest peak in the dye lane or Marker
Marker	locus location of the peak
Allele	bin location of the peak (based on kit/system panel and ladder analysis of project)
Difference	absolute value of distance between the peak center and <i>Bin</i> center in basepairs
Quality	assigns Pass/Check/Undetermined quality ranking for each peak relative to the Allele Evaluation <i>Peak Score</i> settings in the Run Wizard (see Additional Settings)
Score	an exponential curve based evaluation of the peak; calculation of the value is based on signal-to-noise ratio and peak shape (or morphology)
Start/End	beginning and finish basepairs of the peak's Area calculation
Allele Comments	software and user edited comments for the peak; right mouse click peak in chart to add peak edit comments or select from the drop down list (more in Edit Comments Index)
Sample Comments	user added comments for the sample; right mouse click sample name in the sample tree to add new sample edit comments or select from the drop down list (more in Sample Comments Index)
Quality Reasons	letter code abbreviation(s) of reason(s) for a peak 's <i>Quality</i> assignment if ranked Check/Undetermined